

ROUTING

DATE : 15 JAN 57

~~SECRET~~

1	HTA	4	RMB
2		5	JAG
3		6	ops

7 R

TO : DIRECTOR

25X1A2g FROM : [REDACTED]

ACTION: SA/PC/DCI (1,2,3,4,5,6,7)

INFO : S/C (8)

25X1A8a [REDACTED]

25X1A2g [REDACTED] 2673 (IN 12316) 16597 15 JAN 57

ROUTINE PRECEDENCE

25X1A2g

TO: [REDACTED]

CITE: [REDACTED] 25X1A2g

25X1A2g

REF [REDACTED] 2654 (IN 12316) 12227

25X1A2g [REDACTED]

25X1A2e

1. [REDACTED]
2. RE REF, TESTS CONTINUED FOLL:

A. CLEARED FILM SOAKED 16 HOURS FED THROUGH DRYER WITH SATISFACTORY RESULTS.

25X1A2e B. AEROSOL, DEVELOPER AND SHORTSTOP OMITTED. GERMAN POWDER HARDNER, SAME STRENGTH [REDACTED] USED [REDACTED] ADDED TO NH-5 HYPO. 25X1A2g RESULTS SOME STICKINESS IN DRYER BUT NEARLY SATISFACTORY.

C. ROLLERS REMOVED FROM DRYER AND SANDED. AEROSOL, DEVELOPER AND SHORTSTOP OMITTED. NH-5 HYPO AND NH-5 HARDNER USED MANUFACTURERS RECOMMENDATIONS. RESULTS VERY UNSATISFACTORY.

D. AEROSOL, DEVELOPER AND SHORTSTOP OMITTED. GERMAN POWDERED HARDNER USED DOUBLE STRENGTH. RESULTS UNSATISFACTORY.

3. APPEARS THAT DRYER NOT AT FAULT BUT WILL TEST WITH NEW DRYER, A-14 TYPE, TOMORROW. HIGHLY RECOMMEND FILM MANUFACTURER BE CONSULTED REGARDING PROBLEM. PLS ADVISE SOONEST.

~~SECRET~~

END OF MESSAGE.